Product name	XW6400 Reconstructor computer
Identification code(s)	4522 132 65160 (Purchase) 4522 132 65170 (Modified 4GB BDAS) 4522 132 65180 (Modified 4GB CDAS) 4522 132 65190 (Modified 8GB CDAS)
Total weight [kg]	16 kg
Manufacturer	**Hewlett Packard**
Address	Orteliuslaan 1000
Zip code	3528 BD Utrecht
Country	The Netherlands
Electronic info	452213265xxx_XW6400Recon.pdf

Recycling information

Special Attention	Items	Location
	None	

Batteries	Items, type	Location
	Lithium battery type CR2032 (3V)	Figure 1a

Hazardous substances	Items	Location
	Printed Circuit Boards (PCB) system board (motherboard) with a surface greater than 10 square cm	Figure 1b
	Printed Circuit Boards (PCB)maximal 4 add-in cards (memory) with a surface greater than 10 square cm	Figure 1
	Printed Circuit Boards (PCB)maximal 6 add-in cards (PCI) with a surface greater than 10 square cm	Figure 3
	Printed Circuit Boards (PCB) two in the PSU with a surface greater than 10 square cm	Figure 2
	Ten attached to the power supply PCB cards. Electrolytic capacitors / condensers that measure greater	Figure 2c,2d

	Items	Location
Fluids and gases	**None**	

Name: **WEEE passport Recon computer XW6400**	12NC: **4522 132 65160**	Version: **00** Doc.Date: **2007-05-07**
Author: **Twan Geelen**			Pag.: **1** of **4**	Group No: 579E	Section: **-**		Status: **Authorized**

© PHILIPS MEDICAL SYSTEMS NEDERLAND BV, BEST 2007

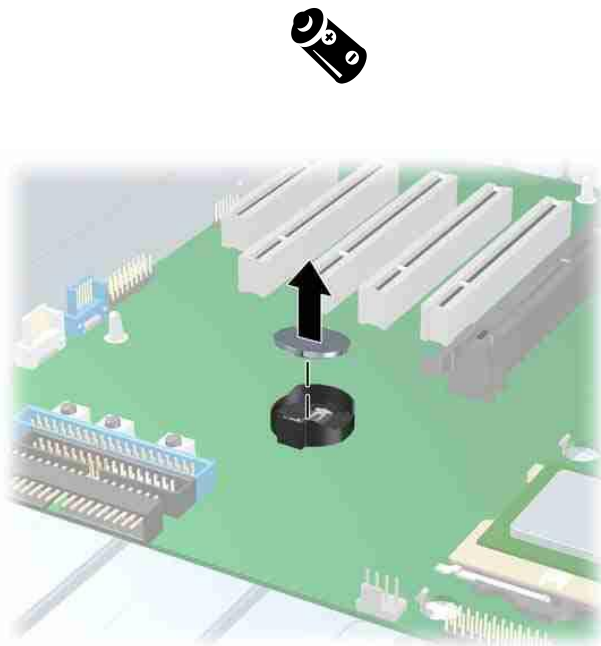# Locations as mentioned in the Passport (Information in pictures)
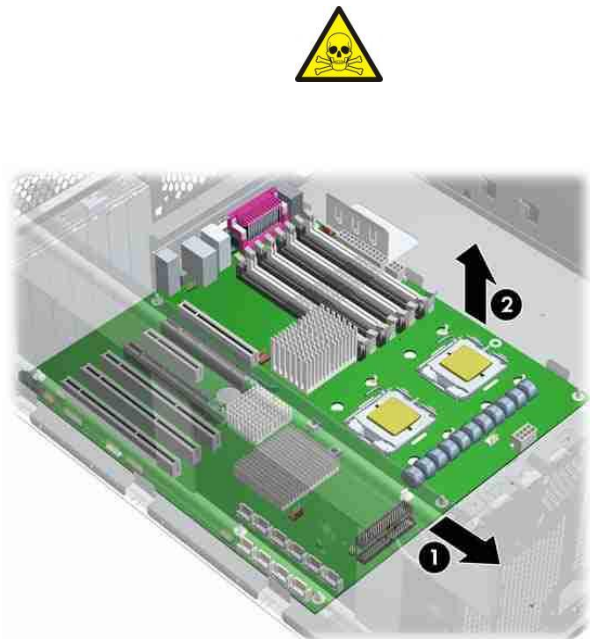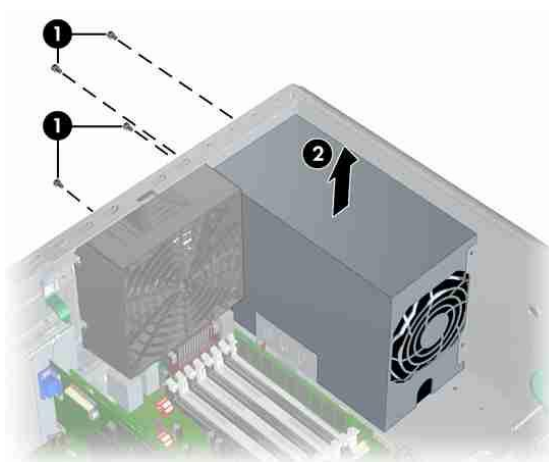

Figure 1a

Figure 1b

Remove the system battery. Press on the release tab of the battery holder. Rotate the battery beyond the latch and lift it straight up.
Remove the system board. Slide the board forward 1 to disengage the mounting standoffs from the chassis. Lift the board out of the chassis 2.

Remove the power supply from the chassis. Disconnect or cut electrical connections to the power supply. Remove the four screws 1 securing the power supply to the workstation

chassis. Slide the power supply toward the front, then lift up to remove it from the chassis 2.

Name: **WEEE passport Recon computer XW6400**				12NC: **4522 132 65160**			Version: **00** Doc.Date: **2007-05-07**
Author: **Twan Geelen**			Pag.: **2** of **4**	Group No: 579E	Section: **-**		Status: **Authorized**

Ensure that all capacitors are safely discharged. Use a diagonal cutter to remove the desired components from both PCB cards. (Note that some components may need to be unsoldered if a diagonal cutter does not fit

between the component and the PCB card.)
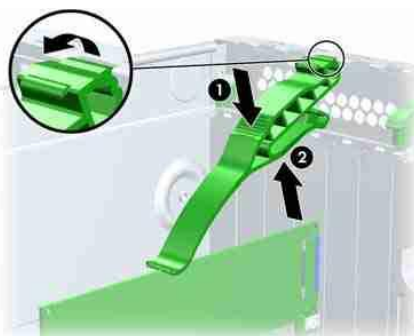

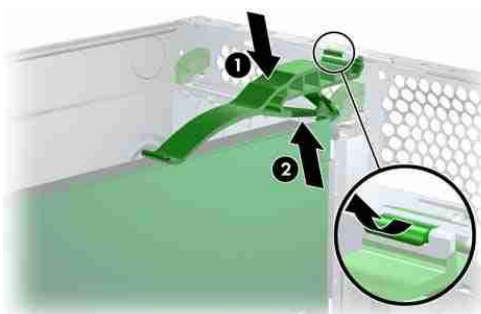Figure 2c   Figure 2d

Remove the graphics card and any other expansion cards.
If necessary, first remove the PCI Holder for short or tall cards. Lift the holder arm with one hand, press in on the sides of the holder 1, and rotate it out of the chassis 2.

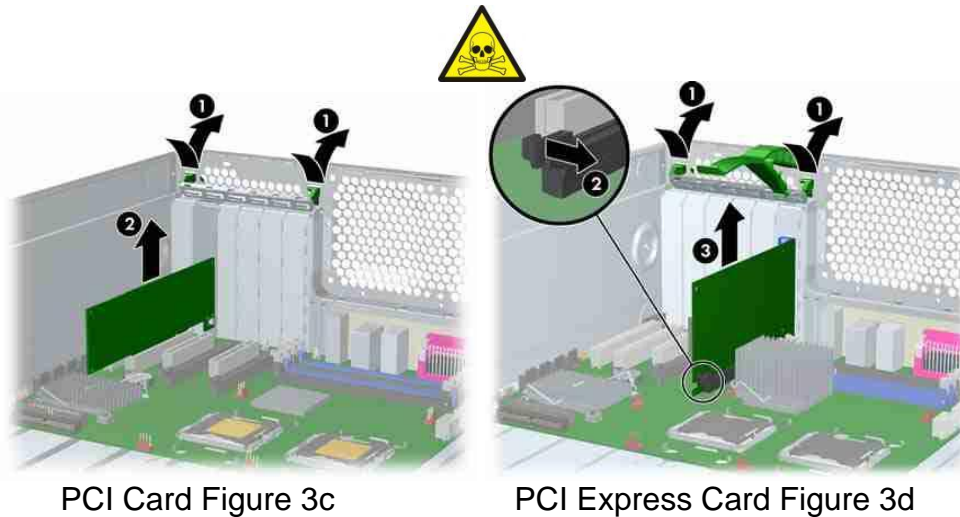Short Card Figure 3a   Tall Card Figure 3b

Remove the PCI retainer clamp by pressing down on the green snaps and rotating the PCI retention clamp upward 1. Lift the PCI card out of the chassis 2. (Figure 3a, 3b and 3c.)

For PCI Express cards (Figure 3d), remove the PCI retainer clamp by pressing down on the green snaps and rotating the PCI retention clamp upward 1. Remove the power supply cable (not shown) if required. Then move the PCI slot lever 2_to release the card and lift it out of the chassis 3.

Name: **WEEE passport Recon computer XW6400**				12NC: **4522 132 65160**		Version: **00** Doc.Date: **2007-05-07**
Author: **Twan Geelen**			Pag.: **3** of **4**	Group No: 579E	Section: **-**	Status: **Authorized**

© **PHILIPS MEDICAL SYSTEMS NEDERLAND BV, BEST 2007**

PCI Card Figure 3c   PCI Express Card Figure 3d

Recycling Passport Revision History

Revision	Description	Date
00	Initial version	2007-05-07

Recycling Passport Approval Signatures

Written By Twan Geelen	Reviewed By (optional)
Approved By Twan Geelen	**Approved By**